

Condition Report

Date: 5/11/2024 Property Condition: Repairable

Assignment Number 484-405-0006

Loss Recap for Repairable

Damage Appraisal..\$5,576.32 Percent of ACV...... 14.63% Deductible.....\$1,000.00

Total...........\$4,576.32 Approximate ACV...\$38,125.00

Office:

Assignment Received: 5/9/2024 Date of Loss: 5/6/2024

Date of First Contact: 5/10/2024

Date of Inspection: 5/11/2024

Inspection Location:

Vehicle/Owner Information:

Insured: Clay County Vehicle: 2023 Ford Explorer VIN #: 1FM5K8AC0PGA32340

Wichita Falls, TX (Corp) #484

100 Energy Way Ste 1900 FORT WORTH TX

Phone: 888-970-3055

Fax: 800-866-4732

Repair Facility:

215 W GILBERT HENRIETTA, TX 76365

None Specified

Loss Recap

Estimated Amount of Open Damages: 2000.00

Estimated Salvage Value: 0.00

Repair Facility Estimate Amount: 0.00

Recommendation: Repairable

Primary Damage: Left Front Corner

Secondary Damage:

Damage Appraisal: \$5,576.32

Claim #: APD20240684-1

Policy #:

Agreed Scope of Damage: No

Days to Repair: 5

Appearance Allowance: No

Betterment/Depreciation: No Applicable: False

Reason:

Tow Charges: 0.00

Storage Rate Per Day / Total: N/A

Direction to Pay: No

Drivable: Yes

Condition Summary

Interior: Good

Engine: 3.0 Paint: Good

Mileage: 32340

Special Equipment:

Approx Cost of Special

Equipment: 0.00

Tire Information:

Tread Depth:

LF:7 RF: 7

LR:7 RR: 7

Size: 255/60/18

Type: GOODYEAR

Remarks Open Items POSSIBLE OPEN ITEMS NOT VISIBLE IN FIELD. The vehicle was inspected at the owner's work location. The owner was present at the time of inspection. Damages consistient with FOL. Officer said ne hit a small hog. He also sent me photos which I included in file.

Alacrity Solutions Wichita Falls TX PO Box 471909, FORT WORTH, TX 76147

Office: (888) 970-3055 Fax: (800) 866-4732 wichitafalls@alacritysas.com Estimate ID 4844050006 Original

Claim Number APD20240684-1

For all supplements or inquiries, please refer to contact information above.

Insured

Clay County

(940) 704-5525 (Work)

215 W Gilbert Henrietta, TX 76365

trent.sharp@co.clay.tx.us

Appraiser

Dustin Buckley

TX License 2992206

Classification None

Insurance Carrier

TEXAS ASSOCIATION OF COUNTIES

Deductible

1000.00 - Not Waived

Additional Information

CONTACT DATE Fri May 10 2024 12:11:00 GMT-0500 (Central Daylight Time)

TEXAS ASSOCIATION OF COUNTIES

Loss Type Collision Claim Number

APD20240684-1

Stephen Sanchez

(512) 615-8996 (Work) stephens@county.org

Loss Date

05/06/2024

Inspection Site Clay County

215 W Gilbert

Henrietta, TX 76365 (940) 704-5525 (Work) Adjuster

Inspection Date 5/11/2024

Additional Information

UNDERWRITING COMPANY

N/A

FULL CLAIM NUMBER

APD20240684-1

INSURANCE CARRIER

TEXAS ASSOCIATION OF

COUNTIES

CARRIER STREET ADDRESS 1204 SAN ANTONIO

CARRIER CITY, STATE, ZIP

AUSTIN, TX 78701

Loss Type

N/A

2023 Ford Police Interceptor Utility Fleet 4 Door Utility 3.0L 6 Cyl Gas Injected Turbocharged AWD

Exterior Color

Interior Color

License

VIN

70P (Flash Grey Metallic)

BLACK

TX-1551738

1FM5K8AC0PGA32340

5/11/2024 12:30 PM

Mitchell Estimating 24.1 OEM MAY_24_V

Mitchell Cloud Estimating TM Copyright 1994-2024 Mitchell International, Inc. All Rights Reserved

Printed On 5/11/2024 12:30 PM

Profile (Madfind) South Central Profile 21.0

Page 1 of 6

Condition Good

Drivable Yes

Odometer 32340

Production Date 12/2022

Mitchell Service Code

912181

Primary Point of Impact Left Front Corner (11)

Prior Damage Notes

NA

Options

Air Conditioning

Automatic Headlights

Driver Seat With Power

Lumbar Support First Row Bucket Seat

Power Driver Seat

Rear Bench Seat

Side Airbags

Trailer Hitch

All Wheel Drive

Auxiliary Input

Driver-Front Air Bag

Left-Curtain Air Bag Power Remote Mirror

Rear Gate Wiper

Steering Wheel Mounted Audio Control Trip Computer

AM-FM Stereo

Bluetooth Wireless Connectivity

Dual A/C

MP3 Player **Power Steering**

Rear Spoiler

Tilt Steering Wheel

Anti-Lock Brake Sys. (ABS)

Cloth Seat

Electric Defogger Passenger-Front Air Bag

Power Windows

Rearview Camera

Tire Pressure Monitoring

System

Auto Air Condition

Cruise Control

Electronic Stability Control

Power Door Locks

Privacy Glass

Second Row Side Airbag With

Head Protection

Traction Control/Electronic

Clay County | 2023 Ford Police Interceptor Utility Fleet

Parts Profile **TEXAS PARTS** Parts Profile Version

11.0

				LA	BOR			PAR'			
Line #		Description	Operation	Type	Total Units	CEG	Type	Number	Qty	Total Price	Tax
Front	Bumper										
1	AUTO	Frt Bumper Cover Assy	Overhaul	Body	3.8	3.8	Existing				
2	201457	Frt Upr Bumper Cover	Remove / Replace	Body	INC	3.8	New	LB5Z 17D957 SCPTM	1	\$574.02	Yes
3	AUTO	Frt Upr Bumper Cover	Refinish Only	Refinish	2.7 C	2.7					
4	201473	L Frt Bumper Side Cover	Remove / Replace	Body	INC#	0.3	Aftermarket CAPA	FO1038193C	1	\$66.00	Yes
5	201487	Frt Lwr Bumper Cover	Remove / Replace	Body	INC#	1.0	Aftermarket CAPA	FO1015134C	1	\$224.00	Yes
6	AUTO	Frt Bumper Cover	Remove / Install	Body	INC	1.6					
7	900500	Grille Guard	Remove / Install	Body*	2.5*	0.0	Existing				
Grille											
8	202257	Grille Assembly	Remove / Replace	Body	INC#	0.5	New	LB5Z 8200 FC	1	\$613.15	Yes
Front	Lamps										
9	200578	L Front Combination Lamp	Remove / Install	Body	0.3#	0.3	Existing				
Front	Fender										
10	200537	L Fender Panel	Repair	Body	1.5*#	2.0	Existing				

		-	LAB	OR			PART			
Line#	Description	Operation	Туре	Total Units	CEG	Type	Number	Qty	Total Price	Tax
11 AUTO	L Fender Outside	Refinish Only	Refinish	1.2* C	2.0	Existing				
12 900501	Partial Refinish									
13 200543	L Fender Liner	Remove / Replace	Body	INC	0.4	Aftermarket CAPA	FO1248204-C	1	\$105.00	Yes
14 202155	R Fender Wheel Opening Mldg	Remove / Replace	Body	0.7#	0.7	New	LB5Z 16038 AC	1	\$295.08	Yes
15 202156	L Fender Wheel Opening Mldg	Remove / Replace	Body	0.7#	0.7	New	LB5Z 16039 AC	1	\$286.22	Yes
Engine / Body (Under Covers									
16 201535	Underbody Front Air Deflector	Remove / Replace	Body	0.4	0.4	New	L1MZ 8310 D	1	\$320.83	Yes
17 201549	Ctr Skid Plate	Remove / Replace	Body	0.5	0.5	New	£1MZ 78001A08 B	1	\$552.42	Yes
18 201537	Engine Plate	Remove / Replace	Body	0.0	0.0	New	L1MZ 78001A08 C	1	\$48.13	Yes
19 201539	R Underbody Side Floor Cover	Remove / Replace	Body	0.5	0.5	New	L1MZ 7811782 H	1	\$585.85	Yes
20 201540	L Underbody Side Floor Cover	Remove / Replace	Body	0.5	0.5	New	L1MZ 7811782 K	1	\$282.02	Ye
Additional Cost	ts & Materials									
21 AUTO	Paint/Materials	Additional Cost							\$259.60*	Yes
22 AUTO	Hazardous Waste Disposal	Additional Cost							\$5.00*	Yes
23 936014	Flex Additive	Additional Cost							\$8.00*	Yes
Additional Ope	rations									
24 AUTO	Clear Coat	Additional Operation	Refinish	1.5	0.0				\$0.00	
25 933003	Tint Color	Additional Operation	Refinish	0.5*	0.0				\$0.00	
26 933005	Restore Corrosion Protection	Additional Operation	Body	0.3*	0.0				\$10.00*	
27 933017	Finish Sand And Buff	Additional Operation	Refinish	1.0*	0.0				\$0.00	
28 933018	Mask For Overspray	Additional Operation	Body*	0.3*	0.0				\$5.00*	
29 933023	Disconnect/Reconnect Computer(S)	Additional Operation	Mechanical	0.3*	0.0				\$0.00	
30 931127	Pre Repair Scan	Additional Operation	Mechanical	0.5*	0.0				\$0.00	
31 931128	Post Repair Scan	Additional Operation	Mechanical	0.5*	0.0				\$0.00	

^{*} Judgment Item

Parts Vendors

T Included in Two Tone Calculation

[#] Labor Note Applies

d Discontinued by Manufacturer

C Included in Clear Coat Calculation

A Included in Clear Coat and Two Tone Calculation

r CEG R&R Time Used for this Labor Operation

^[] Verify the part number and price before ordering

KEYSTONE KEYSIQ 307 DEPORT DR. WACO TX 76712 (866) 247-5165 (Work) (254) 751-1559 (Work)

KEYSTONE KEYSIQ 1101 E. RICHEY RD. HOUSTON TX 77073 (281) 444-5559 (Work) (800) 460-8714 (Work)

Line	Part #	Total Price
4	FO1038193C	\$66.00

Line	Part #	Total
Line	raitw	Price
5	FO1015134C	\$224.00

UCC/NEW WORLD-DFW 1720 E. HWY 356 (214)352-1191 EXT. 232 IRVING TX 75060 (214) 352-1191 (Work)

Line	Part #	Total Price
13	FO1248204-C	\$105.00

Disclaimer: This estimate has been prepared based on the use of replacement parts supplied by a source other than the manufacturer of your motor vehicle. Warranties applicable to these replacement parts are provided by the manufacturer or distributor of these parts rather than the manufacturer of your vehicle.

Estimate Totals					
Labor	Units	Rate	Sublet Add'l Amount		Totals
Body Labor	12.0	\$66.00	\$15.00		\$807.00
Refinish Labor	6.9	\$60.00			\$414.00
Mechanical Labor	1.3	\$100.00			\$130.00
Total Labor	20.2				\$1,351.00
				Taxable	\$1,351.00
				Tax 0.0000%	\$0.00
				Non-Taxable	\$0.00
				Pre-Tax Discount 0.00%	\$0.00
				Labor Total	\$1,351.00
Parts Taxable Parts		Amount \$3,952.72			\$3,952.72
Taxable Faits		\$0,732.72		Parts Adjustments	\$0.00
				Tax 0.0000%	\$0.00
				Non-Taxable	\$0.00
				Pre-Tax Discount 0.00%	\$0.00
				Parts Total	\$3,952.72
Costs		Amount			
Paint Materials		\$259.60			\$259.60
Shop Materials		\$0.00			\$0.00
Other Additional Costs		\$13.00			\$13.00

Estimate Totals

Latimate rotars			
		Taxable	\$272.60
D		Tax 0.0000%	\$0.00
Paint Materials:		Non-Taxable	\$0.00
- Rate: \$44.00		Pre-Tax Discount 0.00	% \$0.00
- Rate Max: 99.9 units		Costs Total	\$272.60
- Additional Rate: \$0.00		Costs rotal	\$272.00
Gross Totals	Amount		
Gross Total	\$5,576.32		\$5,576.32
		Taxable	\$5,576.32
		Tax	\$0.00
		Non-Taxable	\$0.00
		Pre-Tax Discount	\$0.00
	21	0.00%	
		Gross Total	\$5,576.32
Adjustments	Amount		
Deductible	-\$1,000.00		-\$1,000.00
Total Customer Responsibility			-\$1,000.00
		Net Estimate Total	\$4,576.32

This appraisal is subject to the complete review and approval by the assigning insurance company to assure accuracy, cost effectiveness, and that accepted industry repair standards are met. The insurance company listed has the right to accept or reject any part or all of this appraisal or make any changes they feel necessary.

This is not an authorization for repair. All costs of repairs are the sole responsibility of the vehicle owner, who must authorize all repairs. Failure to deliver a copy of this appraisal to the repair shop by the vehicle owner may result in out of pocket expense to the

vehicle owner. Providing a copy of this appraisal is not an acceptance of coverage or liability and all issues of coverage or liability are to be determined by the insurance carrier.

Deductibles may or may not be addressed or included in this appraisal. If applicable, the repairer should collect the deductible from the vehicle owner prior to the release of the repaired vehicle.

It is the repairer's responsibility to send notification of the supplement via fax or email including a statement whether the repairs have been halted on the vehicle. Alacrity Solutions will respond to your request within 24 hours. Please allow 48 hours to complete supplement processing from the date of request to ensure timely release of the vehicle.

Disclaimer: Any person who knowingly presents a false or fraudulent claim for payment of a loss or benefit or knowingly presents false information in an application for insurance is guilty of a crime and may be subject to fines and confinement in prison.

Estimate Event Log

Job Created 5/9/2024 02:32 PM **Estimate Started** 5/11/2024 12:14 PM **Estimate Printed** 5/11/2024 12:30 PM **Estimate Committed** 5/11/2024 12:30 PM

Estimate Version

Estimate Retrieval ID 1001287943

Estimate ID: 4844050006

Supplement#: 0

Owner/Insured: Clay County

Estimate Commit Date: 05/11/2024

Profile Name: 1 Alacrity_Standard

Profile Version: 6.0 Estimating System: Mitchell

Estimate Compliance: Passed

Non-Compliance Items

Line # Description Actual Guideline

Estimator Comment(s):

Notes:

Estimate Compliance History:

Revision 2: Passed

Line # Description Actual Guideline

Revision 1: Warning

Line#	Description	Actual	Guideline
10	Fender - Consider Partial Refinish or Paintless Repair L Fender Panel	1.50 Hrs	2.00 Hrs




Document Name: ANIMAL FROM OFFICER.jpg

Remarks:



Document Name: ANIMAL HAIR.jpg

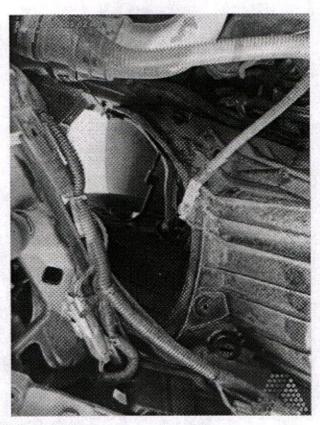


Document Name: INNER FENDER.jpg

Remarks:



Document Name: INNER FENDER (2).jpg

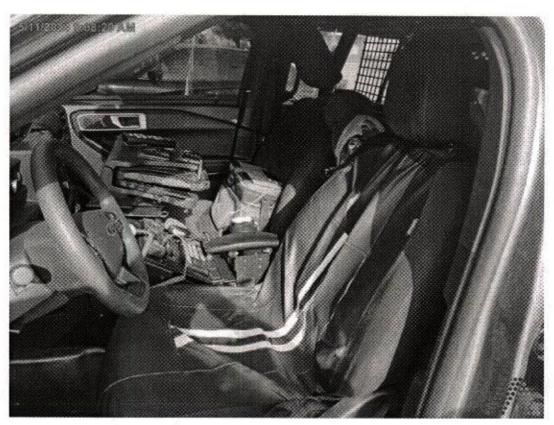


Document Name: INTERIOR.jpg

Remarks:



Document Name: LEFTFRONT.jpg

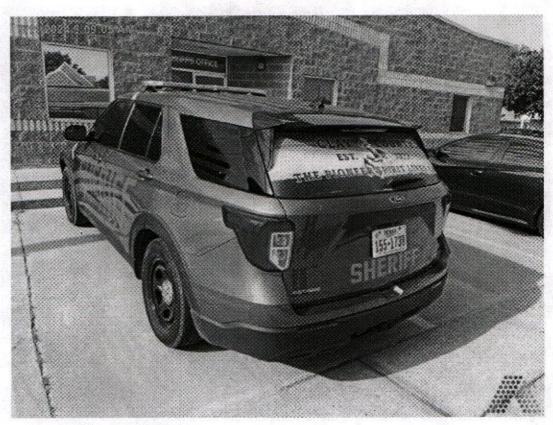


Document Name: LEFTREAR.jpg


Remarks:



Document Name: LF BUMPER.jpg

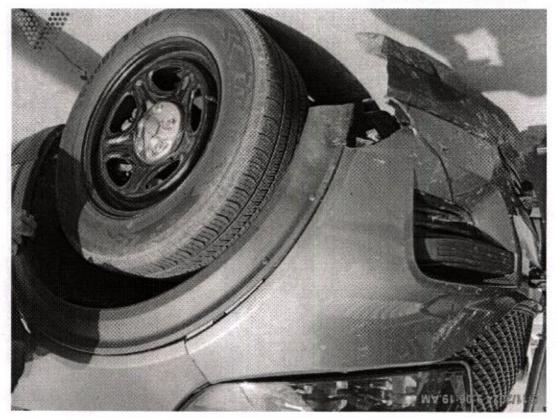

Document Name: LF CORNER.jpg Remarks:

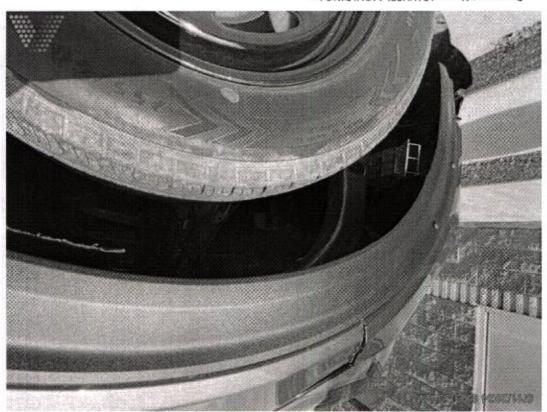

Document Name: LF WHEEL MOULDING. Jpg

gemarks:



Document Name: LICENSE.jpg

Remarks:



Document Name: ODOMETER.jpg



Document Name: ON SCENE PHOTO FROMM OFFICER.jpg Remarks:



Document Name: ONN SCENE PHOTO FROM OFFICER.jpg Remarks:



Document Name: ONSCENE PHOTO FROM OFFICER.jpg

Remarks:




Document Name: RF WHEEL MOULDING.jpg




Document Name: RIGHTFRONT.jpg

Remarks:

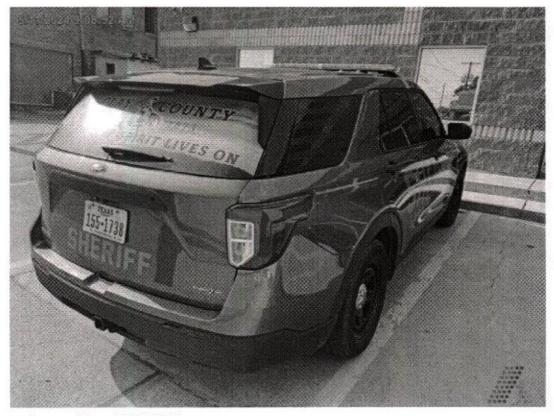


Document Name: RIGHTREAR.jpg

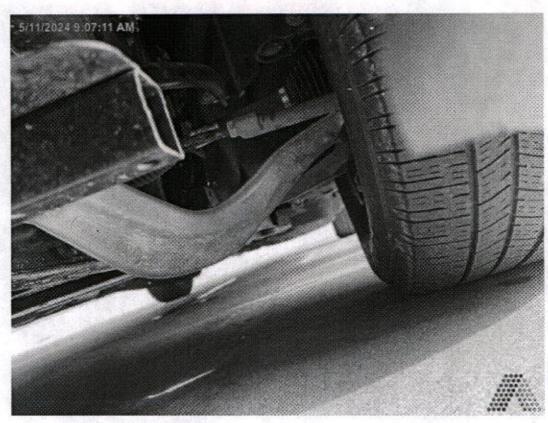


Document Name: UNDERCARRIAGE.jpg

Remarks:

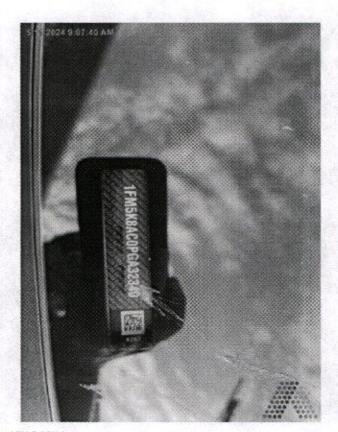

Document Name: VIN DASH.jpg

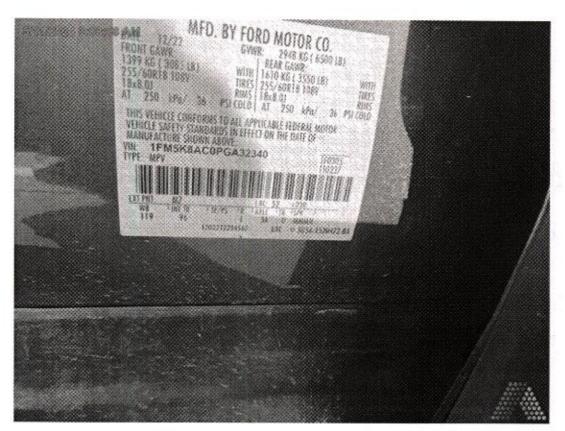

Document Name: VIN DOOR.jpg