

Property Con Assignm	9/16/2024 dition: Repairable ent Number 409-0010	Loss Recap for Repairable Damage Appraisal\$6,831.85 Percent of ACV\$1,000.00 Total\$5,831.85 Approximate ACV\$19,275.00				
(Office:		Assignment Received: 9/12/	2024 [Date of Loss: 8/28/2024	
Wichita Falls, TX (Corp) #484 100 Energy Way Ste 1900			Date of First Contact: 9/13/2	2024 Date	e of Inspection: 9/16/2024	
FORT WORTH TX Phone: 888-970-3055 Fax: 800-866-4732				spection Locatio BERT HENRIETTA		
Vehicle/Ow	ner Information:			Repair Facility:		
Insured: Clay County Laura Lee B Vehicle: 2017 Chevrolet Tahoe VIN #: 1GNLCDEC5HR195882	Brock	None Specified	12	S		
Loss Recap				0		
Estimated Amount of Open Damages: 1500.00Recommendation: RepEstimated Salvage Value: 0.00Primary Damage: RighRepair Facility Estimate Amount: 0.00Damage Appraisal: \$6			Right Front Corner e:	t Front Corner Claim #: APD20241527-1 Policy #:		
Agreed Scope of Damage: No Days to Repair: 8 Appearance Allowance: No	Betterment/Depreciati Applicable: False Reason:		ow Charges: 0.00 orage Rate Per Day / Total: N/A		Direction to Pay: No Drivable: No	
		Condition Su	ummary			
		Interior: Good Paint: Good	Engine: 5.3L V8 Mileage: 0		Special Equipment: ROOF LIGHT BAR / GRILL GUARD W/LIGHTS	
		Tire Inform Tread Depth: (In 32nd's) LF:7 RF: 7 LR:7 RR: 7 Spare:0	nation: Size: 265/60R17 Type: FIRESTONE		Approx Cost of Special Equipment: 0.00	
Remarks			Open Items			
			-			
The vehicle was inspected at the present at the time of inspection Supplement expected for decal Odometer and production date of key to the vehicle. Registration sticker on the windshield.	 No Frame or Suspen replacement and possi could not be obtain bec 	sion Damage Visible. ible hidden damages. cause I did not have a	NEED INVOICES. POSS			

Alacrity Solutions Wichita Falls TX

PO Box 471909, FORT WORTH, TX 76147 Office: (888) 970-3055 Fax: (800) 866-4732 wichitafalls@alacritysas.com

Estimate ID 4844090010 Original Claim Number

APD20241527-1

Submit all supplement requests to: https://supplements.alacritystatus.com

Insured **Clay County Laura Lee Brock** 215 W Gilbert St Henrietta, TX 76365 (940) 538-5560 (Work) lauralee.brock@co.clay.tx.us

Appraiser **Dustin Buckley**

TX License 2992206

Classification None

Insurance Carrier **TEXAS ASSOCIATION OF** COUNTIES

Additional Information

CONTACT DATE Fri Sep 13 2024 10:47:00 GMT-0500 (Central Daylight Time)

TEXAS ASSOCIATION OF COUNTIES

Loss Type Collision Claim Number APD20241527-1 Adjuster Stephen Sanchez (512) 615-8996 (Work) stephens@county.org

Deductible 1000.00 - Not Waived

Loss Date 08/28/2024 Inspection Site Clay County Laura Lee Brock 9/16/2024 215 W Gilbert St Henrietta, TX 76365 (940) 538-5560 (Work)

Inspection Date

Additional Information

UNDERWRITING COMPANY N/A

FULL CLAIM NUMBER APD20241527-1

INSURANCE CARRIER TEXAS ASSOCIATION OF COUNTIES

CARRIER STREET ADDRESS **1204 SAN ANTONIO**

CARRIER CITY, STATE, ZIP **AUSTIN, TX 78701**

Loss Type ANIMAL

2017 Chevrolet Tahoe Police Fleet 4 Door Utility 5.3L 8 Cyl Gas Injected 2WD

Exterior Color	License	VIN	Condition
SILVER	TX-HZG2942	1GNLCDEC5HR195882	Good

Committed On 9/16/2024 11:35 AM

Version Mitchell Estimating 24.2 OEM SEP_24_V

Mitchell Cloud Estimating TM Copyright 1994-2024 Mitchell International, Inc. All Rights Reserved Printed On 9/16/2024 11:35 AM

Profile (Modified) South Central Profile 25.0

Page 1 of 7

Drivable **Yes**

Odometer **Unknown**

Mitchell Service Code 911675

Primary Point of Impact Right Front Corner (1)

Options

Air Conditioning	AM-FM Stereo	Anti-Lock Brake Sys. (ABS)	Auto Air Condition	Automatic Headlights
Auxiliary Input	Bluetooth Wireless Connectivity	CD Player	Cloth Seat	Cruise Control
Daytime Running Lights	Driver Seat With Power Lumbar Support	Driver-Front Air Bag	Dual A/C	Electric Defogger
Electronic Parking Aid	Electronic Stability Control	First Row Split Bench Seat	Front Seats With Power Lumbar Support	Heated Mirror
Keyless Entry System	Left-Curtain Air Bag	Limited Slip Differential	MP3 Player	Passenger-Front Air Bag
Power Door Locks	Power Driver Seat	Power Passenger Seat	Power Remote Mirror	Power Steering
Power Windows	Privacy Glass	Rain Sensing Wipers	Rear Bench Seat	Rear Heating, Ventilation & Air Conditioning
Rearview Camera	Running Boards	Second Row Side Airbag With Head Protection	Side Airbags	Telematic Systems
Theft Deterrent Sys.	Third Row Seat	Tilt Steering Wheel	Tire Pressure Monitoring System	Traction Control/Electronic
Trailer Hitch				

Clay County Laura Lee Brock | 2017 Chevrolet Tahoe Police Fleet

Parts Profile	Parts Profile Version
TEXAS PARTS	18.0

		,	LABO	DR			PAR	Г —		
Line #	Description	Operation	Туре	Total Units	CEG	Туре	Number	Qty	Total Price	Tax
Information La	bels									
1 100155	Inform Label Emission Control	Remove / Replace	Body	0.0	0.0	OE Discount	19257194	1	\$31.07	
Front Bumper										
2 AUTO	Frt Bumper Cover Assy	Overhaul	Body	2.8#	2.8	Existing				
3 100788	Frt Bumper Cover	Remove / Replace	Body	INC#	2.8	Qual Recycled Part	~374128271	1	\$417.00	
4 900510	Line Markup 25.0%								\$104.25	
5 AUTO	Frt Bumper Cover	Refinish Only	Refinish	2.6 C	2.6					
6 100809	Frt Lwr Bumper Moulding	Remove / Replace	Body	INC#	0.3	Aftermarket New	GM1044135	1	\$102.00	
7 AUTO	Frt Bumper Cover	Remove / Install	Body	INC#	1.7					
8 100814	Frt Lwr Bumper Air Deflector	Remove / Replace	Body	INC#	0.4	Aftermarket New	GM1095201	1	\$91.00	
9 900500	ROUGHNECK GRILL GUARD	Remove / Replace	Body*	1.0*	0.0	New	BGGRC15TS	1	\$799.00*	
10 900501	TRAILSENDTRUCK.COM									
Grille										
11 100768	Grille Assembly	Remove / Replace	Body	INC#	0.5	Qual Recycled Part	~398374634	1	\$433.00	
12 900510	Line Markup 25.0%								\$108.25	
Front Lamps										

Committed On 9/16/2024 11:35 AM Mitchell Cloud EstimatingTM Copyright 1994-2024 Mitchell International, Inc. All Rights Reserved Printed On 9/16/2024 11:35 AM

Page 2 of 7

			LAI	BOR			PAR	г —		
Line #	Description	Operation	Туре	Total Units	CEG	Туре	Number	Otv	Total Price	Тах
13 101740	L Front Combination Lamp	-	Body	0.2#	0.7	Existing	Number	Qty	Total Trice	Tax
14 101502	R Frt Combination Lamp Assembly	Remove / Replace	Body	INC#	0.7	Qual Recycled Part	~399426015	1	\$613.00	
15 900510	Line Markup 25.0%	•							\$153.25	
16 AUTO	Headlamps	Check / Adjust	Body	0.4	0.4					
Hood		-								
17 100587	Hood Panel (Alum)	Remove / Replace	Body	1.2	1.2	OE Discount	22756628	1	\$705.43	
18 AUTO	Hood Outside	Refinish Only	Refinish	3.0 C	3.0					
19 AUTO	Add For Hood Underside	Refinish Only	Refinish	1.5 C	1.5					
20 100596	Hood Insulator	Remove / Install	Body	INCr	0.3	Existing				
21 900500	A/M ANTENNA	Remove / Install	Body*	0.3*	0.0	Existing				
Front Fender										
22 100640	R Fender Panel	Remove / Replace	Body	4.0#	5.7	OE Discount	22756424	1	\$603.93	
23 AUTO	R Fender Outside	Refinish Only	Refinish	2.1 C	2.5					
24 AUTO	R Add To Edge Fender	Refinish Only	Refinish	1.2 C	1.2					
25 100647	R Fender Insulator	Remove / Replace	Body	INC#	0.2	OE Discount	84342551	1	\$46.75	
26 100651	R Fender Support	Remove / Replace	Body	INC	0.2	OE Discount	23115310	1	\$41.01	
27 100653	R Upr Fender Insulator	Remove / Replace	Body	0.0	0.0	OE Discount	23431218	1	\$17.91	
28 100655	R Fender Brace	Remove / Replace	Body	0.2	0.2	OE Discount	22814873	1	\$14.52	
29 101601	R Fender Liner	Remove / Replace	Body	INC	0.3	Qual Recycled Part	~397167355	1	\$85.00	
30 900510	Line Markup 25.0%								\$21.25	
31 101603	R Fender Protector	Remove / Replace	Body	INC	0.2	OE Discount	23463925	1	\$31.63	
Front Door										
32 100559	R Frt Door Repair Panel	Repair	Body	2.0*#	7.9	Existing				
33 AUTO	R Frt Door Outside	Refinish Only	Refinish	2.0* C	2.7	Existing				
34 900501	Modified Refinish With Full Clear Coat									
35 101927	R Frt Upr Door Window Frame Moulding	Remove / Install	Body	0.3#	0.3	Existing				
36 AUTO	R Frt Door Applique	Remove / Install	Body	0.3#	0.3					
37 100561	R Frt Rear View Mirror	Remove / Install	Body	INC#	0.7	Existing				
38 100563	R Frt Otr Door Belt Moulding	Remove / Install	Body	0.9#	0.9	Existing				
39 101933	R Frt Door Trim Panel	Remove / Install	Body	INC	0.4	Existing				
40 100103	R Frt Otr Door Handle	Remove / Install	Body	0.3	0.3	Existing				

Mitchell Cloud EstimatingTM Copyright 1994-2024 Mitchell International, Inc. All Rights Reserved

			LAB	OR			PART	Г —		
Line#	Description	Operation	Туре	Total Units	CEG	Туре	Number	Qty	Total Price	Tax
Additional Cos	ts & Materials									
41 AUTO	Paint/Materials	Additional Cost							\$400.00	
42 AUTO	Hazardous Waste Disposal	Additional Cost							\$5.00*	
Additional Ope	erations									
43 AUTO	Clear Coat	Additional Operation	Refinish	2.5*	0.0				\$0.00*	
44 900501	Estimate Calculated Using A Preset Threshold Amount For The Clear Coat									
45 931127	Pre Repair Scan	Additional Operation	Mechanical	0.5*	0.0				\$0.00	
46 931128	Post Repair Scan	Additional Operation	Mechanical	0.5*	0.0				\$0.00	
47 933005	Restore Corrosion Protection	Additional Operation	Body	0.2*	0.0				\$10.00*	
48 933003	Tint Color	Additional Operation	Refinish	0.5*	0.0				\$0.00	
49 933018	Mask For Overspray	Additional Operation	Refinish	0.0*	0.0				\$5.00*	
50 933066	Cover Car	Additional Operation	Refinish	0.0*	0.0				\$5.00*	
Body Compone	ents									
51 931112	Running Boards	Remove / Install	Body	0.5*	0.0	Existing				
52 900501	R SIDE ONLY									
* Judgment Item			C Included in C	lear Coat Calculat	ion					
T Included in Tw	o Tone Calculation		A Included in C	lear Coat and Two	Tone Calcula	ation				
# Labor Note Ap	plies		r CEG R&R Tim	e Used for this Lab	or Operation	ı				
d Discontinued b	by Manufacturer		[] Verify the pa	art number and pri	ce before ord	lering				
Parts Ven	dors									

CLASSIC CHEVROLET OEMD 1101 W. STATE HWY 114 GRAPEVINE TX 76051 (866) 673-1597 (Work)

Line Part #		Total Price
17	22756628	\$705.43
22	22756424	\$603.93

HEWLETT GM OEMD 200 COMMERCE BL. GEORGETOWN TX 78626 (800) 901-2990 (Work)

Line	Part #	Total Price
1	19257194	\$31.07

UCC/NEW WORLD-DFW 1720 E. HWY 356 (214)352-1191 EXT. 232 IRVING TX 75060 (214) 352-1191 (Work)

WEST POINT AUTO PTS OEMD 16835 KATY FWY HOUSTON TX 77094 (800) 364-6444 (Work)

Line	Part #	Total Price	Line	Part #	Total Price
6	GM1044135	\$102.00	25	84342551	\$46.75
8	GM1095201	\$91.00	26	23115310	\$41.01
			27	23431218	\$17.91
			28	22814873	\$14.52
			31	23463925	\$31.63

Disclaimer: This estimate has been prepared based on the use of replacement parts supplied by a source other than the manufacturer of your motor vehicle. Warranties applicable to these replacement parts are provided by the manufacturer or distributor of these parts rather than the manufacturer of your vehicle.

Recycled Part Vendors

LKQ North Texas 904 I-45 South Hutchins TX 75141 (972) 225-1600 (Work) **Total Price** Vehicle VIN Line Part # Description 3 ~374128271 \$417.00 2020 Supplier Notes: Bumper Cover - Front !NOT PAINTED! !!BARE NEEDS BUFF!!, QuoteID:2658366731 11 ~398374634 \$433.00 2020 Supplier Notes: Grille W/O OFF ROAD APPEARANCE PACKAGE; W/O BLACK BOWTIE; PREMIER (OPT 1LZ), QuoteID:2658373437 14 ~399426015 \$613.00 2017 Supplier Notes: Headlamp Assembly LT,4DR R, W/O HID; W/O BLUE TINT; R., QuoteID:2658396312 29 ~397167355 \$85.00 2019 Supplier Notes: Inner Fender Liner LT,4DR R, R., QuoteID:2658411357

Disclaimer: Recycled part pricing may represent either actual pricing (the price at which the recycler is willing to sell the part for in its existing condition) or undamaged pricing (the price at which the recycler would sell the part if it was in undamaged condition). If you are unsure, please contact the automotive recycler. Some parts located for this quote may be interchangeable but may not be an exact match. If you are unsure, please contact the automotive recycler.

Estimate Totals				
Labor	Units	Rate	Sublet Add'l Amount	Totals
Body Labor	14.6	\$66.00	\$10.00	\$973.60
Refinish Labor	15.4	\$60.00	\$10.00	\$934.00

Committed On	
9/16/2024	
11:35 AM	

Version Mitchell Estimating 24.2 OEM SEP_24_V Mitchell Cloud EstimatingTM Copyright 1994-2024 Mitchell International, Inc. All Rights Reserved Printed On 9/16/2024 11:35 AM

25.0

Page 5 of 7

Estimate Totals Mechanical Labor Total Labor	1.0 \$100.00 31.0		\$100.00 \$2,007.60
		Taxable	\$0.00
		Tax 0.0000%	\$0.00
		Non-Taxable	\$2,007.60
		Pre-Tax Discount 0.00%	\$0.00
		Labor Total	\$2,007.60
Parts Taxable Parts	Amount \$0.00		\$0.00
	40.00	Parts Adjustments	\$387.00
		Tax 0.0000%	\$0.00
		Non-Taxable	\$4,032.25
		Pre-Tax Discount 0.00%	\$0.00
		Parts Total	\$4,419.25
Costs	Amount		
Paint Materials	\$400.00		\$400.00
Shop Materials	\$0.00		\$0.00
Other Additional Costs	\$5.00		\$5.00
Paint Materials:		Taxable	\$0.00
- Refinish Units: 15.4 units		Tax 0.0000%	\$0.00
- Rate: \$44.00		Non-Taxable	\$405.00
- Rate Max: 99.9 units		Pre-Tax Discount 0.	•••••
- Additional Rate: \$0.00		Costs Total	\$405.00
Gross Totals	Amount		<i>¢ / 004 05</i>
Gross Total	\$6,831.85		\$6,831.85
		Taxable	\$0.00
		Tax	\$0.00
		Non-Taxable Pre-Tax Discount	\$6,831.85 \$0.00
		0.00%	\$0.00
		Gross Total	\$6,831.85
Adjustments Doductible	Amount		¢1 000 00
Deductible	-\$1,000.00		-\$1,000.00
Total Customer Responsibility			-\$1,000.00
- ,		Net Estimate Total	\$5,831.85

This is not an authorization for repair. All costs of repairs are the sole responsibility of the vehicle owner, who must authorize all repairs. Failure to deliver a copy of this appraisal to the repair shop by the vehicle owner may result in out of pocket expense to the vehicle owner. Providing a copy of this appraisal is not an acceptance of coverage or liability and all issues of coverage or liability are to be determined by the insurance carrier.

Deductibles may or may not be addressed or included in this appraisal. If applicable, the repairer should collect the deductible from the vehicle owner before releasing the repaired vehicle.

It is the repairer's responsibility to send notification of the supplement via our supplement link, fax or email including a statement whether the repairs have been halted on the vehicle. Alacrity Solutions will respond to your request within 24 hours. Please allow 48 hours to complete the supplement processing from the request date to ensure the vehicle is released.

Disclaimer: Any person who knowingly presents a false or fraudulent claim for payment of a loss or benefit or knowingly presents false information in an application for insurance is guilty of a crime and may be subject to fines and confinement in prison.

Estimate Event Log

Job Created	9/12/2024 10:30 PM
Estimate Started	9/16/2024 11:04 AM
Estimate Printed	9/16/2024 11:35 AM
Estimate Committed	9/16/2024 11:35 AM
Estimate Version	0
Estimate Retrieval ID	1002926566

Claim #: APD20241527-1 Estimate ID: 4844090010 Supplement #: 0 Owner/Insured: Laura Lee Brock, Clay County Estimate Commit Date: 09/16/2024

Estimate Compliance: Warning

Non-Compliance Items

Line #	Description	Actual	Guideline
NA	Mileage missing	0	0
NA	Production Date Missing	0	0

Estimator Comment(s):

Notes: VEHICLE LOCKED @ INSPECTION

Estimate Compliance History:

Revision 6: Warning

Line #	Description	Actual	Guideline
NA	Mileage missing	0	0
NA	Production Date Missing	0	0

Revision 5: Warning

Line #	Description	Actual	Guideline
NA	Mileage missing	0	0
NA	Production Date Missing	0	0

Revision 4: Warning

Line #	Description	Actual	Guideline
NA	Mileage missing	0	0
NA	Production Date Missing	0	0
32	Door - Consider Partial Refinish or Paintless Repair: R Frt Door Repair Panel	2.00 Hrs	2.00 Hrs

Revision 3: Failed

Line #	Description	Actual	Guideline
NA	Mileage missing	0	0
NA	Production Date Missing	0	0
32	Door - Consider Partial Refinish or Paintless Repair: R Frt Door Repair Panel	2.00 Hrs	2.00 Hrs
49	Cover Car exceeds carrier threshold	\$ 18.00	\$ 5.00

Revision 2: Failed

Line #	Description	Actual	Guideline
NA	Mileage missing	0	0
NA	Production Date Missing	0	0
32	Door - Consider Partial Refinish or Paintless Repair: R Frt Door Repair Panel	2.00 Hrs	2.00 Hrs
49	Cover Car exceeds carrier threshold	\$ 18.00	\$ 5.00

Revision 1: Failed

Line #	Description	Actual	Guideline
NA	Mileage missing	0	0
NA	Production Date Missing	0	0
32	Door - Consider Partial Refinish or Paintless Repair: R Frt Door Repair Panel	2.00 Hrs	2.00 Hrs
49	Cover Car exceeds carrier threshold	\$ 18.00	\$ 5.00

Buy with monthly payments Get a real-time decision







Roughneck HD Grille Guard 2015-Current Tahoe/Suburban (BGGRC15TS)

Learn more

(0) Reviews: Write first review SKU: **BGGRC15TS**

Price Match Guarantee!

This image is a representation of the product only. Actual product may vary in appearance.

Our Price \$799.00

Starting at \$50/mo or 0% APR with affirm

Customize Your Item	

			Delivery Options		* REQUIRED
			- Delivery Option	ns -	~
			Qty: 1	😭 Add to Cart	
				Add to Wishlist	
			ltem Inquiry		
PROP 65 NOTICE	VEHICLE FITMENT	DETAILS			
Prop 65 Notice	2				

ATTENTION STATE OF CALIFORNIA CONSUMERS: *WARNING* Cancer and reproductive harm-www.p65warnings.ca.gov

Customer Reviews

🤝 Total Reviews (0)
-------------------	----

Nrite the First Review!	
/ou must login to post a review.	
Email	
Password	
Login New Customer Forgot Password	



- 888-504-0959
- O Mon Fri 8:00 AM 5:00 PM CST
- ☑ info@trailsendtruck.com
- 8148 West Freeway Fort Worth, TX 76108



SHOP ONLINE

Bed Covers Bumpers Camper Shells Catalytic Converter Covers Electronics **Exterior Accessories** Featured Products Flat Beds Grille Guards Headache Racks Interior Accessories Jeep Lighting Misc Steps Suspension Tanks / Pumps **Tool Boxes** Towing Weekly Specials

9/16/24, 11:01 AM POLICIES

Privacy Policy

Shipping & Returns

Frequently Asked Questions

ABOUT

About Us

Our Brands

Site Map

Contact

News

п



COPYRIGHT © 2024 TRAILS END TRUCK. ALL RIGHTS RESERVED. POWERED BY WEB SHOP MANAGER.



Document Name: ANIMAL.jpg Remarks:



Document Name: GRILL DAMAGE(4).jpg Remarks:



Document Name: GRILL GUARD BRAND(7).jpg Remarks:



Document Name: GRILL GUARD DAMAGE(8) (2).jpg Remarks:



Document Name: HOOD(3).jpg Remarks:



Document Name: INNER BRACKET DAMAGE(10).jpg Remarks:



Document Name: INTERIOR.jpg Remarks:



Document Name: LEFTFRONT.jpg Remarks:



Document Name: LEFTREAR.jpg Remarks:



Document Name: LICENSE.jpg Remarks:



Document Name: NEWDAMAGE (9).jpg Remarks:



Document Name: RF CORNER.jpg Remarks:



Document Name: RF DOOR AND FENDER(2).jpg Remarks:



Document Name: RF DOOR(11).jpg Remarks:



Document Name: RF INNER FENDER AND LINER(6).jpg Remarks:




Document Name: RF LAMP (5).jpg Remarks:



Document Name: RIGHTFRONT.jpg Remarks:



Document Name: RIGHTREAR.jpg Remarks:

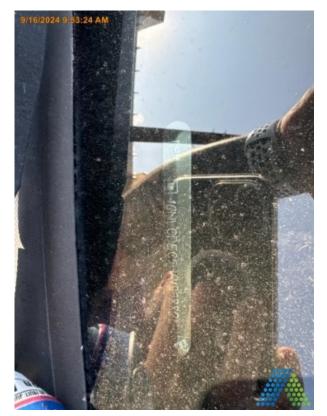

Document Name: VIN DASH.jpg Remarks: